


# Gossamer BB30\_Europe Recall Notice

**Specification:** Gossamer Pro BB30 CK-OS6021CC/ Gossamer Pro Compact BB30 CK-OSC6021CC/ Gossamer BB30 CK-OS6020SS/ Gossamer Compact BB30 CK-OSC6020SS

Full Speed Ahead (FSA) has received reports that the bolt shoulder on the non-drive Gossamer BB30 series crankarms can crack and break if the installer exceeds the recommended torque specification while tightening the crankbolt. If the bolt shoulder is cracked or damaged in any way, the crank arm can potentially loosen, allowing the rider to lose control and fall.



Gossamer BB30 Crankset

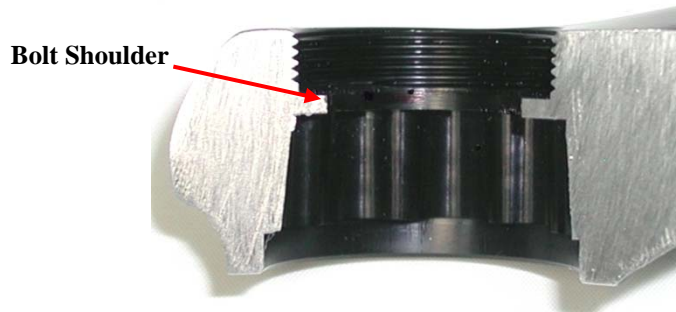

Non-Drive arm cross-section

Gossamer BB30 non-drive crank arms that are subject to recall have serial numbers beginning with 10B, 10C, and 10D, (Figure 1).

Serial numbers are located on the backside of the crankarm by pedal threads (Figure 2). MegaExo crankarms are not affected. Gossamer BB30 Triple cranksets are not affected.

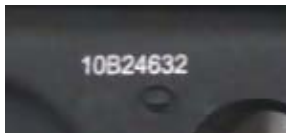


Figure 1: Example Serial Number



Figure 2: Serial Number Location

Gossamer BB30 Cranksets have been assembled as original equipment on the following bicycles for Europe :

**CANNONDALE**  
 CAAD 10 105  
 CAAD 8 105  
 Synapse Carbon 105 / Apex  
 Synapse Alloy 105 / Apex  
 Super Six 5 105

**BIANCHI**  
 SEMPRE Ultegra  
 SEMPRE 105  
 SEMPRE Veloce 10v

Dealers should inspect their inventory of bicycles with Gossamer BB30 cranksets preassembled as OEM equipment. It is also requested that dealers contact customers who may have purchased bicycles with Gossamer BB30 cranksets installed. Bicycles with non-drive crank arms subject to recall should not be ridden until a replacement non-drive crank arm has been installed.

**Contact**

If you have questions, please visit our web site technical section: <http://www.fullspeedahead.com/contact> or contact:

Full Speed Ahead, USA  
 12810 NE 178th St. Suite 102 Woodinville, WA 98072  
 Tel: 1\_425\_488\_8653 Fax: 1\_425\_489\_1082

Full Speed Ahead, Europe  
 Via Del Lavoro, 56 20040 Busnago, Milan, Italy  
 Tel: +39\_039\_688\_5265 Fax: +39\_039\_682\_3336

TH INDUSTRIES / FSA Asia  
 6, Wu-gong 8th Rd., Wufeng Shiang, Taichung County 41353, Taiwan.  
 Tel: +886\_4\_2331\_9134 Fax: +886\_4\_2331\_9314



